

To: ROUSH CleanTech Authorized Service Centers
ROUSH CleanTech Fleet Service Centers

Date: 11/13/2018

Subject:
Heater Hose Retention

Applicable Model(s)/VINs:
2016-2017 F-650/750 all configurations with propane fuel system

Description:
Inspect line retention of the heater hose, vapor bleed line, and fuel return line near the FRPCM.

Procedure:

1. Locate area near the FRPCM (Figure 1)
2. Inspect for 2 C-clip swivel cable ties (Figure 2) separating the heater hose, fuel return line, and vapor bleed line.
3. If C-clip swivel cable ties are missing, install as seen in Figure 3. If C-clip swivel cable ties are installed and any of the lines are contacting each other, remove and reinstall.

Note: If any lines are damaged, replace line.

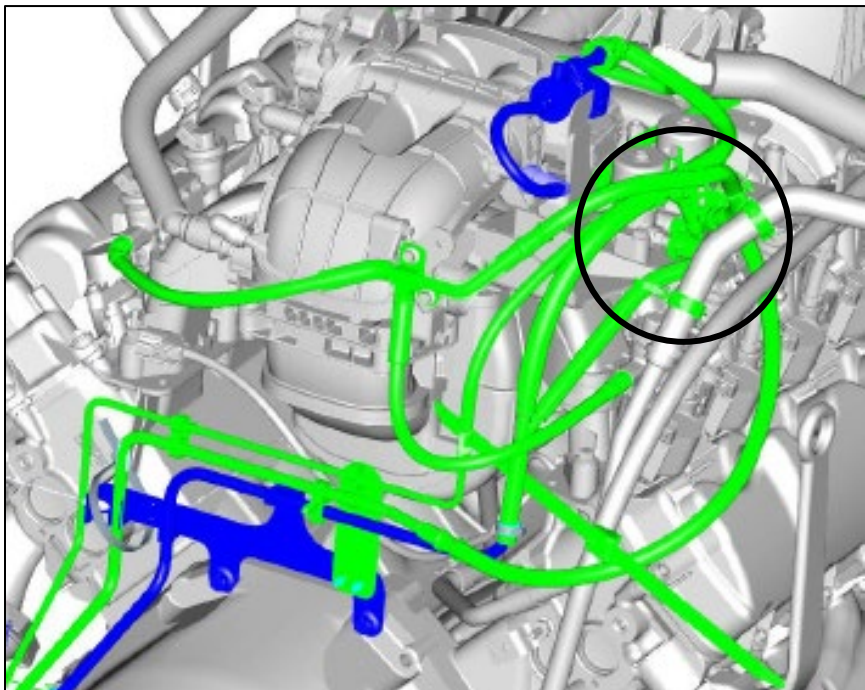


Figure 1



Figure 2

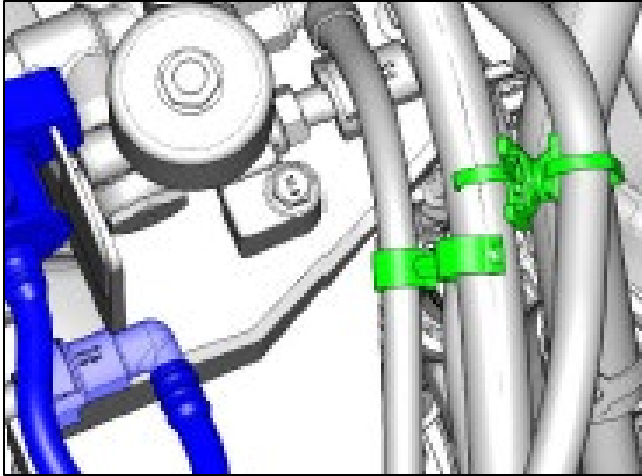


Figure 3

Part(s) Information

Part Number	Description	Qty
156-00130	C-Clip Swivel Cable Tie	2

Warranty Information

If installation or replacement of retention is required, labor and parts are warrantable.

Labor Operation Code	Standard Labor Time
RCTL17A	0.2 hrs

Questions/Assistance:

ROUSH CleanTech Customer Service
 1-800-59-ROUSH (800-597-6874), opt 2
support@roushcleantech.com